

Marvel-Schebler/Tillotson

Division Borg-Warner Corporation, 2195 South Elwin Road, Decatur, Illinois 62525



SERVICE BULLETIN



Feb. 1979

#A1-79

TO: All registered manual holders

SUBJECT: HA-6 Aircraft Carburetor Part No. A10-5206-1

COMPLIANCE: As soon as possible

CARBURETORS AFFECTED:

CZ-0 } Serial Numbers
-1 } 100 Thru 496
-2 }

Except for Numbers 399, 413, 419, 480, 481

To improve the sealing of the internal economizer channel, remove the economizer channel plug #80-150 and replace it with #80-364 brass plug.

Kit #666-821 contains all necessary parts to service two carburetors as this installation is on a Beechcraft Duchess. Complete instructions on reverse side.

Post compliance in log book.

This can be installed with the carburetor on the airplane.




Additional Installation Instructions on Reverse Side



Marvel-Schebler/Tillk Jon Davis

Borg-Warner Corporation
 2195 South Elwin Road, Decatur, Illinois 62525
 Phone 217/428-4631

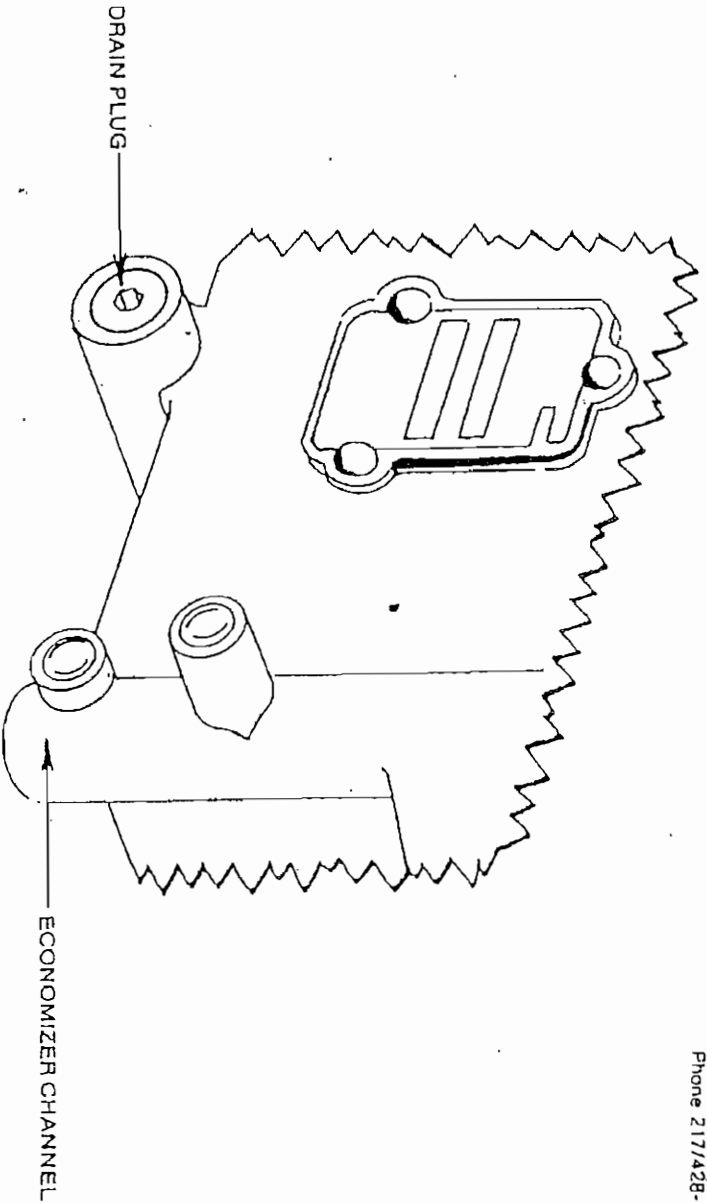

SPECIAL KIT #666-821

QTY.	PART NO.
2	80-364 Plugs (brass)
2	16-A56 Washers
2	298-1 Lead Seals
2	66-12 Safety Wires
1	242 Loctite
1	Instruction Sheet

