



Remove Port Plug
AND Starwasher

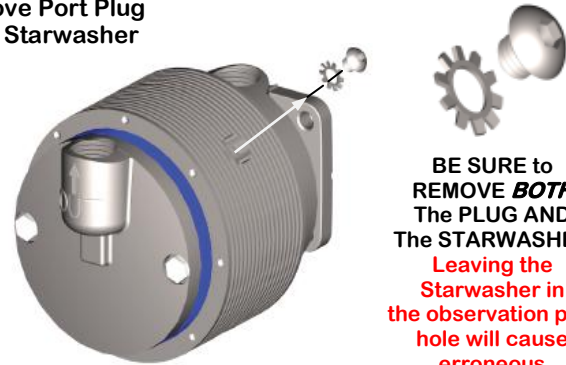

AA442CW Shown Others Similar

BE SURE to REMOVE BOTH The PLUG AND The STARWASHER Leaving the Starwasher in the observation port hole will cause erroneous inspection results

Figure 4

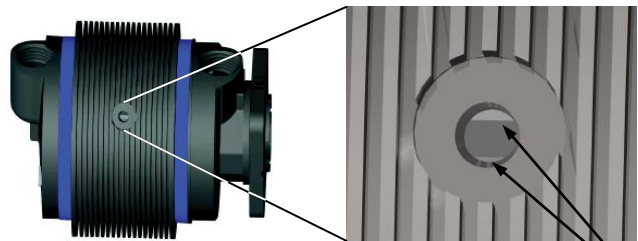

AA442CW Shown Others Similar

NOTE: Edges of rotor slot visible in inspection port hole

Figure 5

240 & 400 Series Wear Indicating Tool
P/N: 82-580122-2A6

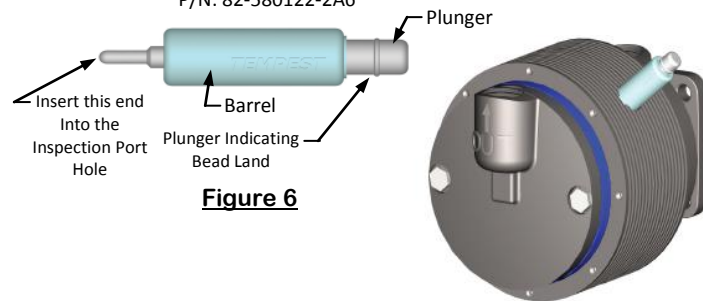


Figure 6

Wear Indicating Tool Installed in Pump Inspection Port Hole

Figure 7

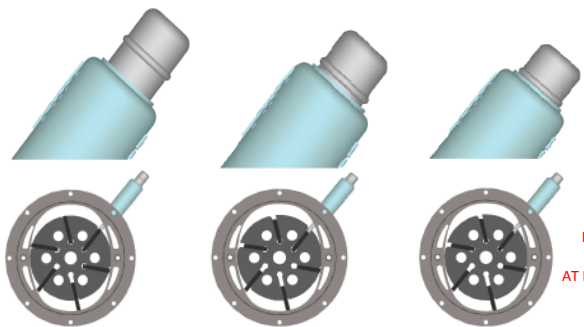


Figure 8-1
New Vane Indication

Figure 8-2
Vane Still Good - Land Not Touching

Figure 8-3
Indicating Bead Land TOUCHING Barrel: Vane at Service Limit REPLACE PUMP

Pump Sectional Views-For Reference Only

IMPORTANT POINTS ABOUT DRY AIR PUMPS

1. Dry air pumps are just that, INTERNALLY DRY. Dry air pumps use the graphite dust produced by the gradual wear of the vanes as lubrication. Any oil leaks, however slight, that permits oil to reach the drive end of the pump may cause internal oil contamination. This contamination combines with the lubricating dust and forms a gummy mixture that binds up the internal components of the pump leading to failure.
2. When cleaning an engine with solvent or water and soap, use a waterproof material to cover the entire pump(s), the pneumatic air filter and regulator(s). Contamination from solvent or water saturation of these areas may be ingested into pump causing failure in much the same way as oil contamination.
3. When a pump fails, vacuum that is present in the inlet hose may suck small particles or carbon up into the hose, even up to the regulator. (Pressure systems, the inlet filter will become contaminated.) Hoses and regulator(s) should be removed and thoroughly cleaned and filters replaced. Particles from the previous failed pump can contaminate new pump and cause FOD damage leading to failure.
4. Teflon tape or other thread compound on threaded fittings or port threads may be ingested into the pump. These substances will bind up lubrication dust and cause FOD damage leading to failure. **It is not necessary to use any type of sealant on fitting threads.**

NOTE: More than 95% of dry air pump failures are the result of one or more of the above points.

New Dry Air Pump Warranty
Dry Air Pumps manufactured by Aero Accessories, Inc. Are warranted against defects in materials and or workmanship for the time periods listed below by model / series number. Aero Accessories, Inc. obligation under this warranty is limited to the repair or replacement at Aero Accessories, Inc. sole discretion any pump that upon inspection by Aero Accessories, Inc. is found to be defective in materials or workmanship.

AA3215CC / AA3216CW	3 YEARS OR 1300 Hours from Time of Installation
AA241CC / AA242CW	1 Year or 500 Hours from Time of Installation
AA441CC / AA442CW	1 Year or 500 Hours from Time of Installation

Contact your local distributor for our new FAA-PMA Vacuum Regulators, Filters, and Fittings

1240 Springwood Avenue, Gibsonville, NC 27249, USA
Tel: 336-449-5054 // 800-822-3200 Fax: 336-449-5461
Website: www.aeroaccessories.com

Tempest Dry Air Pumps are manufactured by Aero Accessories, Inc. In The USA

FAA-PMA Approved

TEMPEST
excellence
Quality Dry Air Pumps



AIA114
100110

Sheet 4 of 4

AA3200, AA240, & AA400 SERIES DRY AIR PUMPS




Tornado AA3215CC, AA3215CC-9, and the AA3216CW Series Dry Air Pumps as well as our AA240 and AA400 Series Dry Air Pumps are truly revolutionary. They incorporate proven technology, designed to provide long service life and reduce premature failures.

Aero Accessories, Inc "Tempest" AA3200 Series, AA240 Series, & AA400 Series Dry Air Pumps incorporate our patented "channel cut" in the mounting flange face, which when utilized with our patented LRT Diverter, is designed to channel oil away from mechanical workings of the pump, if the drive pad's oil seal begins to leak. The Closed Front End is designed to eliminate oil and or / solvent residues from entering the pump's drive mechanism.




Most dry air pumps are installed with the inlet and outlet ports in the 12:00, 3:00, 6:00, or 9:00 positions. Tornado pumps have four (4) exit channels in the mounting flange face. When a pump is installed on an aircraft the three (3) upper-most channels MUST be plugged by the LRT diverter. The bottom channel is left open to allow oil to drain away from the pump's mechanical workings. In other words, the open, unplugged channel should be pointed towards the ground.

The photographs below and on the next page illustrate proper installation positions of the LRT diverter when the pump ports are at different positions.

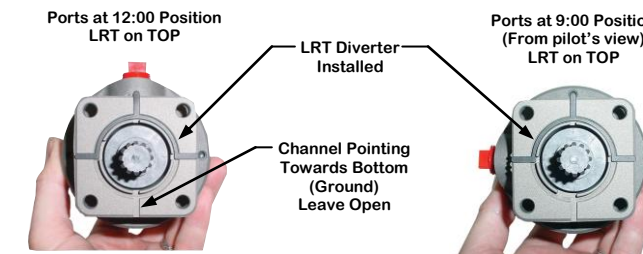


The photographs below show the inlet and outlet ports at the 6:00 and 3:00 positions. Notice that in both pictures the bottom channel is open and pointing towards the ground. The LRT diverter MUST be installed so that the lower drain channel of the mounting flange remains open and pointing towards the ground.

NOTE:
On Cessna 150 / Continental O-200 and some other engines the pump mounts with the drive shaft vertical. Pumps designed for vertical installation such as the AA3215CC-9, AA215CC-9, or AA211CC-9 are normally required. When installing an AA3215CC-9 the open channel should face aft towards the firewall and away from sources of oil contamination. On Cessna 172's having 2 pumps on the engine, the lower pump mounts with the ports slightly rotated at about 20 degrees. The channel pointing closest to the ground should be left open.

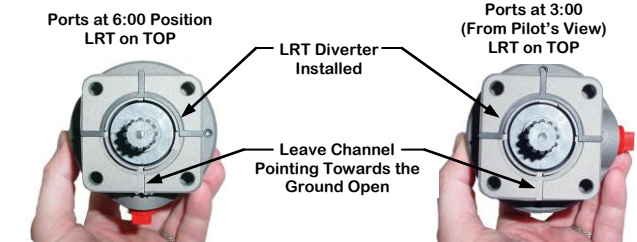


It is important that the LRT diverter is firmly inserted into the upper three (3) channels in the mounting flange face, with the middle leg of the LRT pointing UP, regardless of the pump inlet & outlet port orientation being vertical or horizontal and that the LRT be flush with the flange mounting surface before installing the mounting gasket. (As shown below.)

NOTE: The LRT diverter is not a mounting gasket. Either the 82-50130 or 82-50130-B mounting gasket MUST be used with the LRT diverter when installing a Tempest New Dry Air Pump with the mounting flange that has been machined to accept it. It is suggested that the 82-50130-B gasket be utilized in Dry Air Pump installations due to its increased sealing capability.

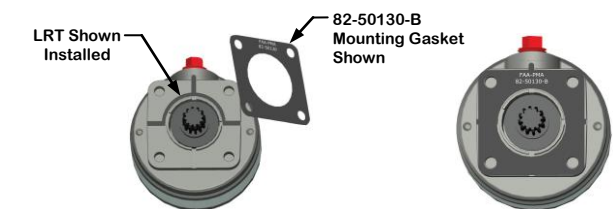

The 82-50130 gasket incorporates 8 small holes for accessories that require engine oil lubrication. The oil passage holes have been eliminated in the 82-50130-B mounting gasket. The LRT diverter is required on the Aero Accessories Dry Air Pumps that have channels milled into their mounting flange faces. Either the 82-50130 or 82-50130-B gaskets can be used with the LRT diverter, however the 'B' gasket is preferred due to its increased sealing capability.

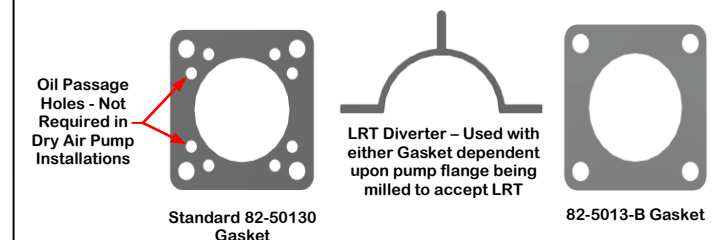


REAR WEAR INDICATOR PORT 3200 SERIES MODELS

AA3215CC, AA3215CC-9 & AA3216CW Models

Aero Accessories, Inc.'s AA3215CC, AA3215CC-9, and AA3216CW dry air pumps feature our patented rear cover wear indicator port. Removal of the port plug allows visual observation to determine vane length. The end of the vane closest to the center of the pump is observed through the small indicator hole in the port. When less than an eighth of the indicator hole is covered by the vane, it is time to replace the pump.

Aero Accessories, Inc. recommends that the first observation be accomplished at 600 hours time-in-service. Subsequent checks should be made each 100 hours of operation or, as deemed necessary based upon wear rate of vane.

Refer to AIA Service Letter No. SL-004

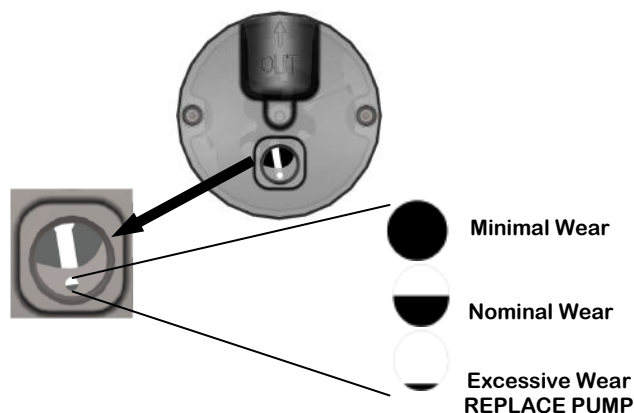

SIDE WEAR INDICATOR PORT AA240 & AA400 SERIES PUMPS

AA241CC / AA242CW & AA441CC / AA442CW Series Models

Aero Accessories, Inc.'s New AA240 & AA400 Series Pumps feature our patented side Wear Indicator Port. Removal of the wear indicator port plug allows insertion of a Vane Wear Indicator Tool. The indication revealed by the tool gives a wear status of the vane. Wear Indicator Ports make it possible to identify and remove pumps from service with vanes worn beyond their service life. Removing such pumps BEFORE THEY FAIL reduces the risk of in-flight failure and improves safety. In addition to using the wear indicator port, always inspect the pump in accordance with the aircraft manufacturer's recommendations as well as for any other defects or conditions such as overheating (crinkled or burned decals), oil contamination, physical damage, looseness of parts and / or hardware, etc., that might render the pump unsuitable for continued service.

If any condition is discovered or suspected that would render the pump unsuitable for continuation in service, replace the pump, regardless of vane wear status.

Aero Accessories recommends the first observation be performed at 300 hours pump time-in-service with future observations every 100 hours until vane is at its service limit. Once vane is at its service limit REPLACE Pump. Aero Accessories, Inc Service Letter SL-005 available at www.aeroaccessories.com

The recommended TBO for AA240 & AA400 series pumps without the WIP is 600 hours. Pumps incorporating the WIP should be removed from service according to the wear indicator port observations.

It is the pilot's / operator's responsibility to determine that the entire pneumatic system is in a safe, serviceable, and airworthy condition. Use the aircraft manufacturer's maintenance instructions and recommendations to determine the status of the entire pneumatic system.

1. Recommended Vane Wear Observation Intervals for AA240 & AA400 Series Dry Air Pumps:

1st Observation - 300 hours pump time-in-service.
Subsequent observations - each 100 hours time-in-service or at annual inspection, whichever comes first, after the initial observation.

2. Safety:

For maximum safety, it is recommended to perform the vane wear inspection during procedures that require the spark plugs be removed, such as engine compression check.

NEVER move the propeller on a 'hot' engine.

ENSURE: Magnetos set to BOTH OFF. Fuel Mixture Closed. Fuel to OFF.

ALWAYS remain clear of the propeller's arc and ensure that other personnel do so.

3. Vane Length Measurement:

NOTE: in most cases, measuring the vanes can be done with the pump mounted on the aircraft. However, if the inspection port hole can not be accessed with the pump mounted, remove it from the engine, turn the pump's shaft by hand, and follow the same general instructions with respect to measuring the vanes. Reinstall the pump in accordance with instructions in the aircraft's maintenance manual.

- "Safe The Engine"; remove the pump cooling shroud if necessary.
- Insure the area around the inspection port plug is clean, so that when the plug is removed nothing can fall into the pump.
- Remove the Inspection Port Plug AND Star Washer, refer to Fig 4. Failure to remove the star washer will cause a false indication.
- While looking into the indicator port, have an assistant slowly move the propeller by hand in the normal direction of rotation, until a vane slot is aligned precisely in the center of the port, refer to Fig 5. If you go too far, just keep turning to the next slot.
- Insert the Vane Wear Indicator Tool, Fig 6, into the inspection port as illustrated in Fig. 7. Hold the barrel securely and squarely against the pump body. With your fingertip, gently push the plunger into the pump's inspection port. When the plunger touches the vane, slight vane movement may be felt if the vane is not at the bottom of its slot.

NOTE: If the plunger does not slip easily into the slot, DO NOT force it. Remove the indicator tool and check for correct alignment of the rotor slot to the port. (Refer to Figure 5.)

DO NOT rotate propeller or pump's shaft when the indicator tool probe is inserted in the inspection port. Doing so may break or chip the rotor. If the pump is turned with the probe in the pump, replace the pump even if you don't think it is damaged. A cracked or chipped rotor may operate normally for a while then fail without warning.

- Observe the plunger's indicating bead land position. If the indicating bead's land is touching the barrel end, the vane is worn to the service limit. REPLACE the pump if any vane is at it's service limit. (Refer to Figures 8-1, 8-2 and 8-3.)
- If the vanes are within service limit and the pump is otherwise serviceable, clean port plug threads, install a NEW starwasher and torque to 45-50 inch-pounds.

DO NOT substitute a different screw or bolt for the plug. Use only the proper starwasher. The use of substitute parts can damage the pump.



Contact Aero Accessories, Inc. to obtain additional plugs and starwashers.

WIP Plug: 82-50122-2A1

Starwasher: 82-50122-2A2 or alternate AN936B-416, MS35355-32, or MS35355-61

- Attach the pump's cooling shroud if removed.
- Enable the ignition system.
- Attach and secure cowling.
- Perform a post maintenance run-up check to verify that the vacuum / pressure system, as well as any other system your work may have affected, is working properly.

PNEUMATIC SYSTEM MAINTENANCE

A. Oil Leaks-

Inspect engine and engine compartment for oil leaks that could contaminate the dry air pump or reach the inlet filter on pressure systems or the vacuum regulator, if located in the engine compartment.

B. Oil Seal-

Inspect drive pad seal, it should be dry. If any oil is found replace the oil seal. (Refer to engine manufacturer's parts manual for correct seal part number and installation instructions.)
RECOMMENDATION: If a new pump is being installed on a midtime engine, replace the oil seal even if the area is dry. The oil seal could start leaking before engine TBO is reached.

C. Filters-

Clean filters are essential for pneumatic system to operate properly. Dirty filters reduce air flow to pump causing the pump to operate at higher temperatures and increasing pump wear. Dirty filters affect operation of pneumatic instruments and regulator(s) and can cause low vacuum or low or excessive pressure.

NOTE: REFER TO AIRCRAFT MAINTENANCE / SERVICE MANUAL FOR FILTER REPLACEMENT SCHEDULE.

D. Pump Fittings-

- Inspect for damage and cleanliness.
- Bent or kinked fittings (Fig. 1) can reduce air flow.
- Check threads for damage, replace if necessary.
- Clean fittings inside and out to remove any loose debris.
- Install fittings as described in Section 2: Dry Air Pump Installation.

E. Hoses-

Remove and inspect hoses for the following conditions;

- Hard, Cracked, Brittle, or Oil Contaminated.
- Determine if liner separation has occurred inside of hose. Liner separation can restrict air flow.
(Replace Hose If Any of These Conditions Is Found)
- If replacing a previously failed pump, thoroughly clean inside of hoses, making sure all loose debris have been removed before attaching hoses.

NOTE: PUMPS INTERNAL CLEARANCES WILL NOT ALLOW FOREIGN PARTICALS TO PASS THROUGH WITHOUT CAUSING DAMAGE OR FAILURE. MAKE SURE HOSES ARE CLEAN.

F. Vacuum Regulator-

Regulator must be clean, oil free and in airworthy condition for proper operation. Replace filter after installing new pump or every 100 hours or annually. Run engine and check for proper operation of regulator. (Refer to Aircraft Service / Maintenance Manual) adjust as necessary for correct vacuum setting for your aircraft. (Tempest™ Regulators should require no field adjustment, contact Aero Accessories, Inc. if a Tempest™ regulator gives an indication of improper operation.)

G. Regulator, Valves and Deice Valves-

Before installing new pump, particularly if old pump has failed prematurely, the following guidelines must be accomplished.

- Determine if pneumatic system problem was cause of failure. This can be accomplished using a commercially available test kit. (Contact Aero Accessories, Inc. for test kit information.)
- Test aircraft's pneumatic system according to outlined instructions supplied with test kit and the Aircraft Service / Maintenance Manual.
- Any regulator, valve or deice valve found to be defective must be replaced in accordance with the Aircraft Service / Maintenance Manual to prevent possible premature failure of new pump after installation on aircraft.

H. Manifolds / Check-

Manifolds and check valves have internal rubber components that can deteriorate from age becoming hard and brittle, and lose their sealing capacity. (Refer to Aircraft Service / Maintenance Manual for manifolds, check valves inspection intervals and procedures.

CAUTION: AIRCRAFT WITH DUAL DRY AIR PUMPS MAY LOSE REDUNDANCY FEATURE IF THE MANIFOLD / CHECK VALVE IS NOT FUNCTIONING PROPERLY.

DRY AIR PUMP INSTALLATION-

- Before installing pump, confirm it is the correct model for the application.
- Perform maintenance check of fittings, hoses, regulator(s) and filters.

NOTE: If previous pump has failed prematurely, perform maintenance system check to insure all components of the pneumatic system are functional and working correctly.

- With new pump gripped by the mounting flange in vice (Fig. 2) Install fittings into ports finger-tight. **(Use NO Pipe Sealant or Tape on threads.)** Tighten with proper wrench, no more than one (1) full turn to required position.
Do Not grip pump by the sides of the pumping chamber (Fig. 3).
- Install pump with new mounting gasket and, if required a LRT Diverter.
- Secure pump with proper mounting hardware and tighten. (Refer to Aircraft Engine Service / Maintenance for specified torque requirements.)
- Attach hose to correct fittings, being careful not to cut the I.D. of the hoses when sliding over end of fittings. Secure hoses with proper hardware.

CAUTION: WHEN INSTALLING PUMP FITTINGS, SECURE PUMP IN VISE BY DRIVE END PAD AS SHOWN IN FIG. 2. SECURING PUMP BY PUMPING CHAMBER, FIG. 3, COULD AFFECT INTERNAL CLEARANCES CAUSING PUMP FAILURE.

FINAL SYSTEMS CHECK-

After new pump is installed and secured, before running engine to check pneumatic system, inspect all hoses, filters, and regulator(s) for proper installation.

Run engine(s) and check operation to verify that pneumatic system is operating within aircraft specifications. (Refer to aircraft specifications. (Refer to Aircraft Service / Maintenance Manual.

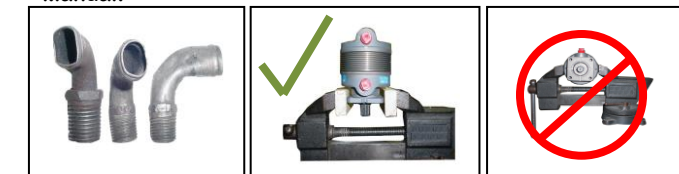


Figure 1

Figure 2

Figure 3

